

Service information


Symptom

Reference no.: GDA_96174

Internal water and steam circuit changed

Cure

INFO: From WK1245 onwards the water and steam circuit in Senseo Latte and Cappuccino Select applainces has changed. To reduce the complexity of the system some parts have been excluded, not affecting the performance of the appliance. in the new situation the appliance will not vent the steam system into the water comtainer, the bypass valve (Pos. 44 in SLS, Pos. 48 in SCS) will connect directly to the valve outlet, next to the 3-way valve.

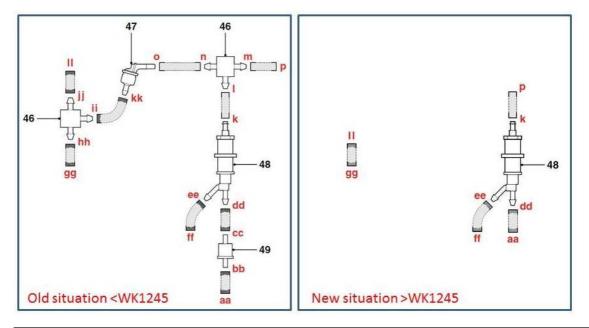

Senseo Latte Select removed:	Senseo Cappuccino Select removed:
Pos. 42 T-piece (2x) Pos. 43 Venting valve Pos. 43 Venting valve Pos. 65 Pos. 90 Pos. 93 Valve Pos. 90 Pos. 93 Valve Pos. 90 Pos. 93 Valve Pos. 90 Pos. 94 Pos. 9	Pos. 46 T-piece (2x) Pos. 47 Venting valve Pos. 47 Venting valve vsituation, as variables have been changed in length and position to assure

Appliances built according to the latest situation can be recognized by an increase of the Service Change Classification:

All HD7853 appliances went from /A to /B
HD7854/60 and HD7854/80 appliances went from /B to /C (EU)
HD7854/84, /86 and /88 appliances went from /A to /B (Brazil & Argentina)

REMARKS: - 12-12-2012 Initial version