



**Service information**

**Reference no.: SDA\_101777**

**Symptom**

CHANGING HYDRAULIC SYSTEM FOR INTELIA CAPPUCCINO LINE 230V

**Cure**

**INFO:**  
Technical Improvement for Hydraulic system in Intelia On Touch Cappuccino 230V.

**CURE:**  
From S/N TU901335143352 the hydraulic system has been modified with elimination of the discharge valve (3-way).

In detail:

- Creation of a new solenoid valve assy (with a single solenoid valve, new pipes and wiring);
- Change the code of black bottom casing (for versioning with closure of the old drain holes);
- Elimination of drip tray presence reed;
- Drip tray modified (new code for removed magnet);
- CPU updated with the new software (V03.05.05);

See in Image 1 the placement of the old solenoid valve assy and in image 2 the placement of the new solenoid valve assy.

For new codes of the individual components refer to the updated exploded views.  
In attached you can find the old and new wiring and hydraulic diagrams.

Image 1



Image 2



**HISTORY:**  
09-10-2013: First Release