



Service information

Reference no.: SDA_102816

Symptom

Uppersticks breaks easily from Lowerstick

Cure

SYMPTOM:

Upperstick will break from Lowerstick

CURE:

A new Service assembly has been created which need to be placed in the Upperstick to prevent breakage : Stick connector.

This new assembly is available as code 4322 009 00851 and can be

ordered via normal Service channels per wk. 1405.

This assembly contains the following parts :

4322 003 48691 CLICK FINGER 4 - 100 PCE

4322 003 48701 BOLT PLATE - 100 PCE

4322 002 20731 SCREW 2.8X16 HEAD 5.8 - 100 PCE

4322 000 00451 CUTTING PLATE - 1 PCE

These are packed in a plastic bag in a labeled box.

INFO:

Instructions for placing these parts, see attachment.

This package as indicated is suitable for 50 appliances, this means per appliance 2x clickfingers, 2x bolt plates and 2x screws.

IMPORTANT :

It is mandatory to add these components to every FC7070 which is coming for repair, independent which reason of return, from the moment these components are available.