

## Service information

## Reference no.: SDA\_106455

# **Symptom**

Coffee residuals between the vibrating plate and coffee beans container in GranBaristo.

## Cure

**Headline:**Coffee residuals between the vibrating plate and coffee beans container in GranBaristo.

**Symptom:**Coffee beans do not fall into the grinder because the vibrating plate doesn't work properly.

**Cure:**Vibrating plate has been improved by adding a molded seal (Image2)

Action: Replace the old vibrating plate by the improved version: For GranBaristo 230V – up to SN TU901422080520 For GranBaristo 120V – up to SN TU901423080628

Code:
The molded seal: 12NC 421944029771 BLK ADDITION.BEAN CONT.V2 CST ASSY. + SEAL (Image2).

### Picture1





SERTAL NUMBER (First serial where solution has been implemented in production): Gran Baristo 230V - TU901422080521
Gran Baristo 120V - TU901423080629

IPM NUMBER (Philips Integrate Problem Management documentation reference number): None.

# INFORMATION FOR CONSUMER:

### HISTORY:

NIJUKY: 11/07/20xx - Third Release Modified the CURE and Actions. 26/02/2016 - Second Release (Inserted Actions:) 25/02/2016 - First Release