



Service information

Reference no.: SDA_107639

Symptom

The Grinder doesn't work open circuit CPU board in Intelia / Intuita.

Cure

INFO:

For Intelia the Error 01 appears after pressing the coffee button but the coffee-grinder motor doesn't start
For Intuita all 4 red led's flashing after pressing the button for coffee.

CURE:


Check the correct functionality of grinder motor and the correct wiring connections by measuring the continuity of the wiring and the presence of an Ohm value between the "+" and "-" Typically between 50 Ω - 100 Ω connection of the motor.

1. If both the grinder motor and the wiring connections are ok proceed as follow:

Check the R13 resistor (shown in the Images 1) by measuring the resistance (330 Ω) and if found defective "No Ohm value", proceed as follow:

- Repair the CPU Board by replacing the R13 resistor with the code **12002020 (996530073852)** RESISTOR 1206 330R 5% 0.25W. (Remark: by ordering code 12002020 (996530073852) you get 20 pieces of R13 resistor)
- In case is not possible to repair the CPU replacing only the resistor, the complete CPU Board replace is required (accordingly with the Exploded View documentation)

Image1

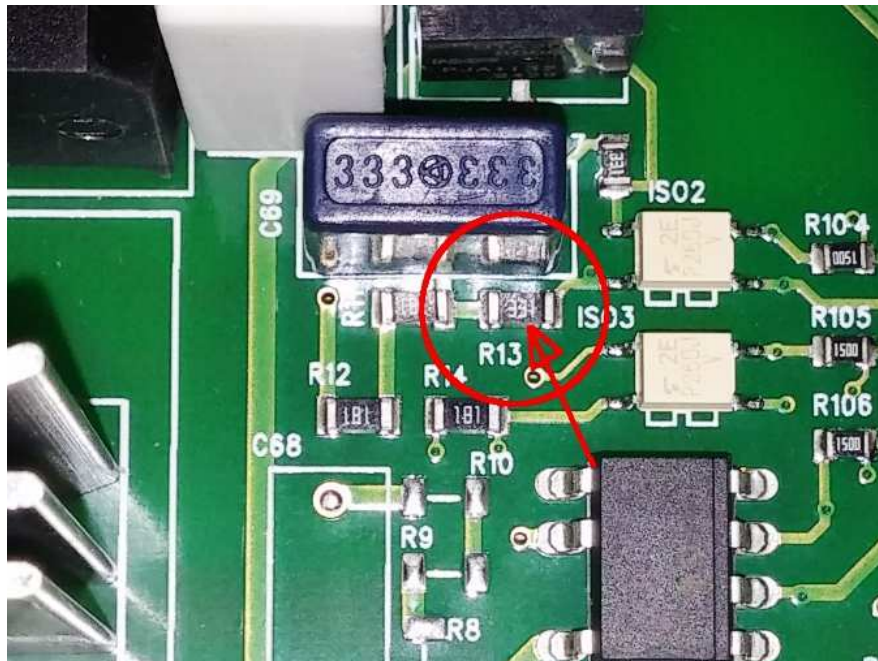

SERIAL NUMBER:
NO

IPM NUMBER:
101897

FAQ NUMBER:
NO

INFORMATION FOR CALL CENTER:
NO

INFORMATION FOR CONSUMER:
NO

REMARK:
04/09/2014 - First review