



Service information

Reference no.: SDA_108003


Symptom

Appliance does not heat due to blown boiler TRIAC S2

Cure

INFO:

The cause for the Boiler TRIAC to blow, is likely to be an earth leakage of the boiler, therefore the boiler must be preventively replaced. Please refer to attached image for an overview of the back (solder side) of the PCBA, and the area to inspect.

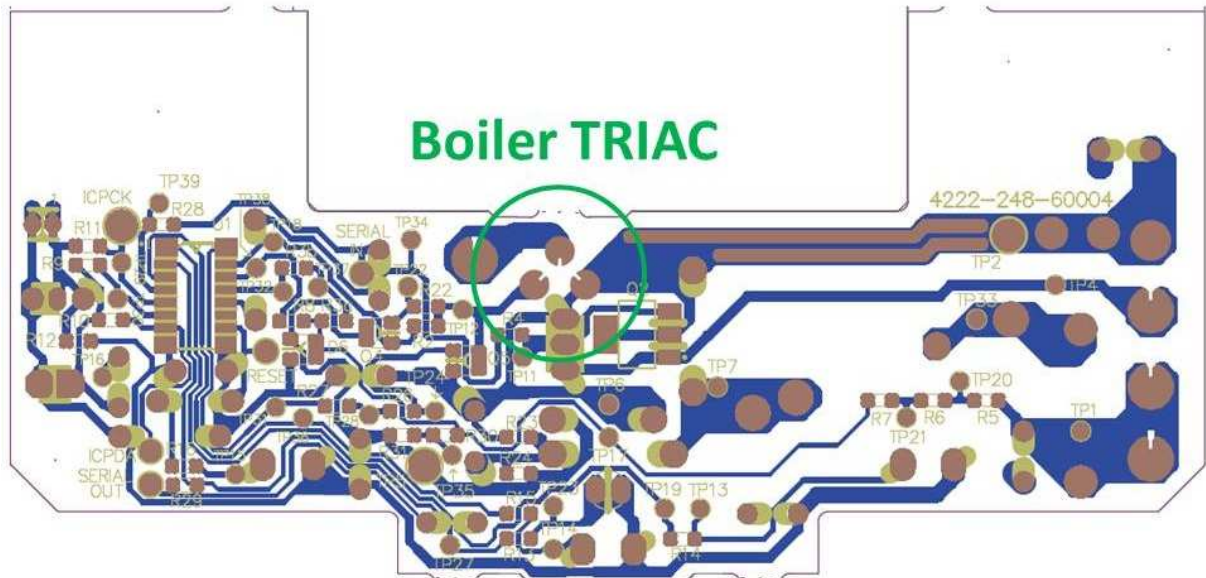

CURE:

Apart from the PCBA

- 422225952711 (for Plastic boiler)
- 422225954363 (for Metal boiler)

also replace the Boiler

- 422225952091 Plastic HV
- 422225949121 Plastic LV
- 422225953272 Metal

REMARKS:

- 30-09-2014: Initial version