



Service information

Reference no.: SDA_108015


Symptom

Appliance does not heat due to blown boiler TRIAC SVC

Cure

INFO:

The cause for the Boiler TRIAC to blow, is likely to be an earth leakage of the boiler, therefore the boiler must be preventively replaced. Please refer to attached image for an overview of the back (solder side) of the PCBA, and the area to inspect.

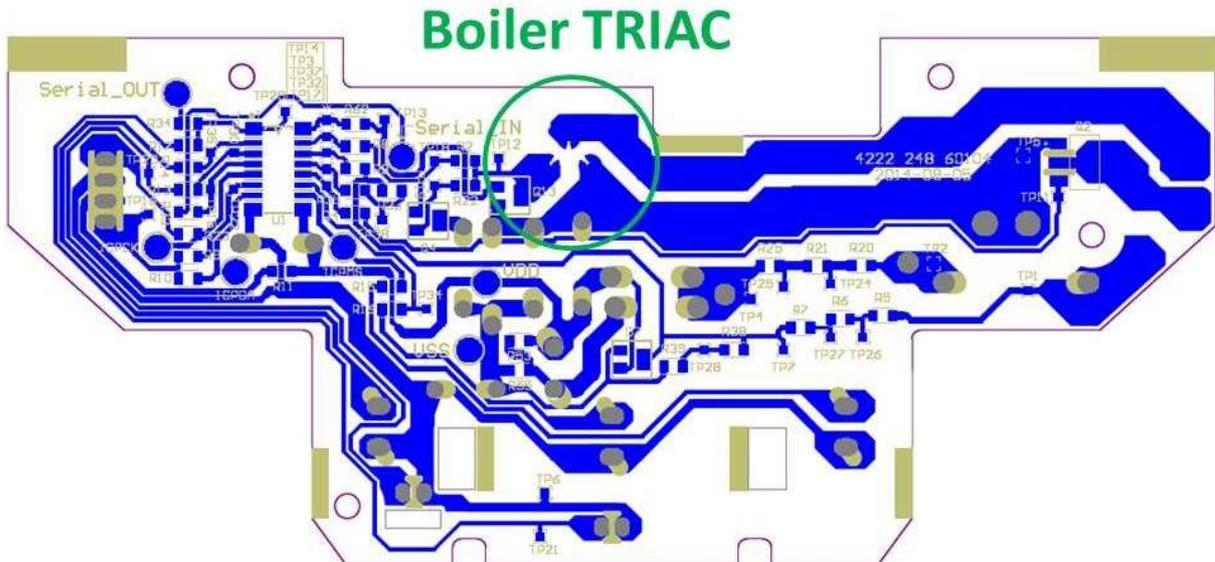

CONL.
Apart from the PCBA

- 422225952721 HD7825
- 422225950632 HD7826/1x
- 422225952721 HD7826
- 422225947313 HD7827
- 422225948881 HD7828
- 422225945043 HD7835

also replace the Boiler

- 422225952091 HV
- 422225949121 LV

REMARKS:
- 30-09-2014: Intial version