



Service information

Reference no.: SDA_108016


Symptom

Appliance does not heat due to blown boiler TRIAC SCS

Cure

INFO:

The cause for the Boiler TRIAC to blow, is likely to be an earth leakage of the boiler, therefore the boiler must be preventively replaced. Please refer to attached image for an overview of the back (solder side) of the PCBA, and the area to inspect.

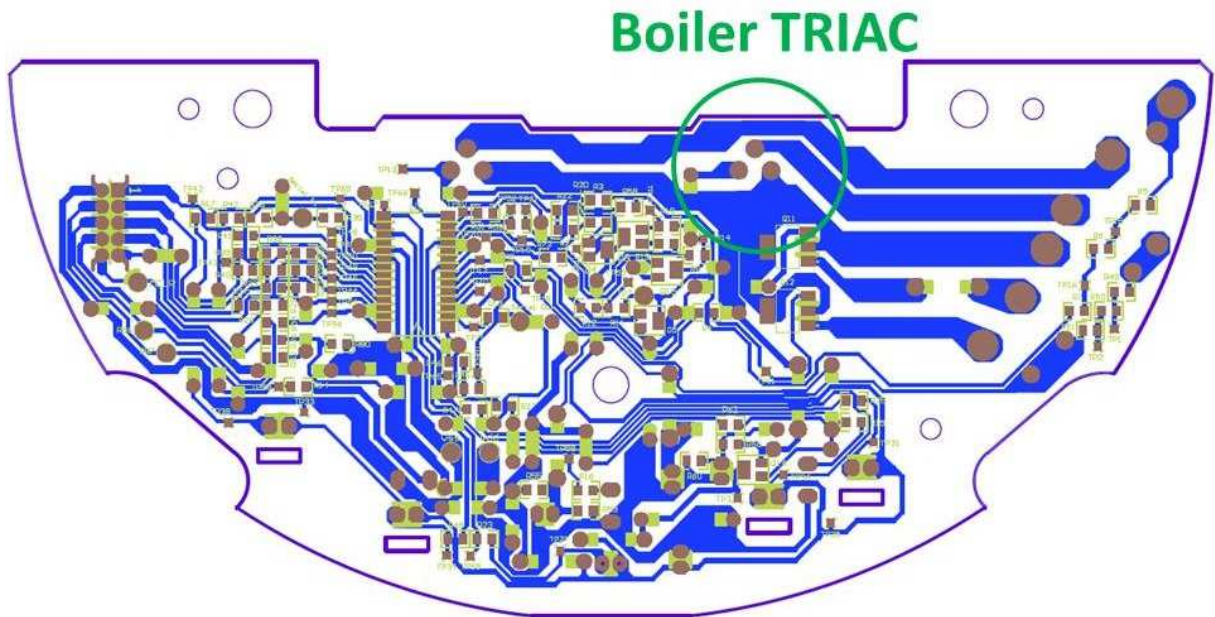

CURE:

Apart from the PCBA

- 422225955011 (Brasil HV, Korea)
- 422225955001 (Brasil LV)
- 422225950288 (WEU)

also replace the Boiler

- 422225952091 HV
- 422225949121 LV

REMARKS:

- 30-09-2014: Intial version