Reference no.: SDA_108017


Service information

Symptom

Appliance does not heat due to blown boiler TRIAC SLS

Cure

INFO:
The cause for the Boiler TRIAC to blow, is likely to be an earth leakage of the boiler, therefore the boiler must be preventively replaced. Please refer to attached image for an overview of the back (solder side) of the PCBA, and the area to inspect.

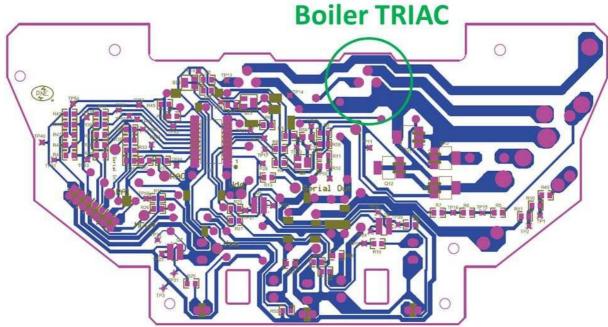

CURE: Apart from the PCBA

- 422225954231 WEU422225954273 Brazil

also replace the Boiler

- 422225952091 Plastic HV422225949121 Plastic LV
- REMARKS: 30-09-2014: Intial version