



Service information

Reference no.: SDA_109326

Symptom

Main Switch sparking during switching in Minuto.

Cure


INFO:

The defect is caused by a bad component supplied by Arcoelectric supplier.

CURE:


Repair the appliance by using the SWITCH GENERAL BIPOLAR 1 / 0 cod. 242212625104 Supplied from a different supplier than the ARCOLECTRIC o (Image1)

Image1

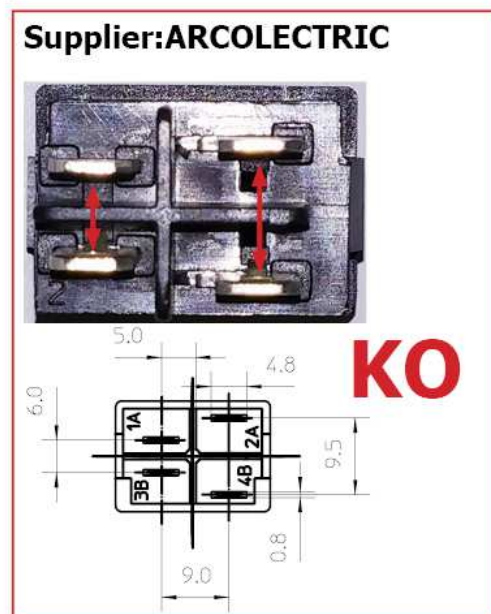

SWITCH GENERAL BIPOLAR 1 / 0 cod. 242212625104 (same code) supplied by other suppliers than ARCOLECTRIC can be identified because they have the same faston interaxes (with or without the plastic cross between contacts). (Image2)

Image2

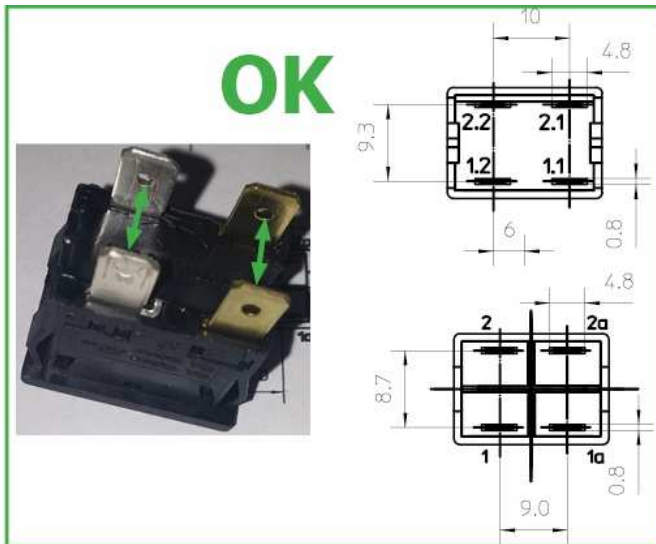

Any stock of the SWITCH GENERAL BIPOLAR I / 0 Supplier ARCOLECTRIC must be scrapped.

ADDITIONAL INFORMATION:

The SWITCH GENERAL BIPOLAR I / 0 of ARCOLECTRIC Supplier on your hand have to be mandatory scrapped.

SERIAL NUMBER (First serial where solution has been implemented in production):

None.

IPM NUMBER (Philips Integrate Problem Management documentation reference number):

101090.

FAQ NUMBER (for Call Center reference):

None.

INFORMATION FOR CALL CENTER:

None.

INFORMATION FOR CONSUMER:

None.

HISTORY:

09/02/2015 - First Release