



Service information

Reference no.: SDA_109902

Symptom

Appliance does not have a stable suction power, sometimes the appliance stops.

Cure

SYMPTOM :

Appliance does not have a stable suction power

The symptoms can be :

- Does not work / No suction power;
- Irregular and fluctuating suction power or sound;
- Unable to regulate suction power correctly by turning the suction power control button.

Possible cause :

The suction power control electronics are broken

INFO:

The models were produced with wrong PCBA, code 4322 006 25051.

CURE:

In total 15.000 pcs. have been reworked on this issue.

In the enclosure you can find the explanation of the reworked PCBA's .

The appliances which are re-worked have the below marking on Rating label, see enclosure 2.

From wk. 1514 the models are produced with the correct PCBA, the code is

4322 006 25481.

Extra remark (9-2-2016) : the PCBA needs to be replaced including the potmeter which will be delivered with this PCBA, otherwise it does not fit !!

The components will be available per 1-5-2015.

Remark:PCBA with code 4322 006 25051 can still be used for HP models (FC865x and FC8662/91 + FC8663/91)