Reference no.: SDA_110407



Service information

Symptom

Door opens after brewing process.

Cure

INFO:Door opens after brewing unit process (while brewing unit is going back to the home position).

CURE:
Action: Proceed by replacing the mounting plate cover code: 996530001899, replace if damaged the black gear wheel (the bigger one)
of the spare part kit code: 996530009913, and replace the brew unit whit a new one revised or clean and grease the actual in use.

ADDITIONAL INFORMATION:
SERIAL NUMBER (First serial where solution has been implemented in production): None

 $\textbf{IPM NUMBER} \ (\text{Philips Integrate Problem Management documentation reference number}): \\ \text{IPM-91964}$

FAQ NUMBER (for Call Center reference): None

INFORMATION FOR CALL CENTER: None

INFORMATION FOR CONSUMER: None

HISTORY: 04/06/2015 - First Release