



Service information

Reference no.: SDA_110566


Symptom

MANDATORY ACTION: GC76xx Hose Cord Assy Improvement

Cure

Symptoms: ECO button & Power button LED blinking alternately in a continuous fashion. The cause is broken yellow signal wire in hose cord assy. There is no continuity of yellow wire connection when using a multimeter to check!

Info: New hose cord is implemented in production from 1450 till 1502 as per transition period. From wk1502 onwards, all sets are using improved part.

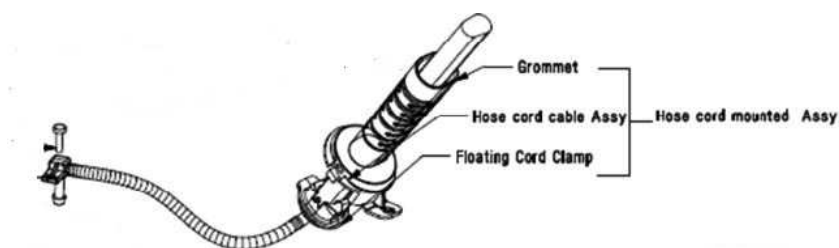

Products affected:
GC76xx

Countries affected:
All

Cure (Mandatory):

For products with production week before < wk1502, please kindly change to the latest part as shown Figure 2 below, regardless of the customer complaint. Please also make sure that the new hose cord assy used are the after improvement part (with 8 wires) as shown in Figure 2 below.

Before Improvement: (7 wires)

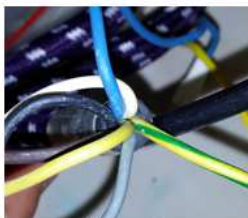


Figure 1

After Improvement:

8 wires with Red dummy wire on the center of the Core



Figure 2

12NC	Part description
42390217735x	HOSE CORD MTD ASSY#
42390217971x	HOSE CORD MTD ASSY#
42390217980x	HOSE CORD MTD ASSY#
42390217991x	HOSE CORD MTD ASSY#
42390218677x	HOSE CORD MTD ASSY#