



Service information

Reference no.: SDA_114084

Symptom

Slipping off water sensor wiring

Cure

Symptom:
Alarm for empty water tank remains always on.

CURE:
Wiring was improved to avoid that the plug of water level sensor is disconnecting from CPU board.



Actions:
In case the plug was disconnected, replace the plug by the improved version and refit it proceed as shown in following images.

Code:
New wiring: 421946035161 3P.CONN.WATER LEVEL V2 SMR UL ASSY


Insert the ring of the wiring on the plate. Block wiring with silicone tube.

1



Pass the wiring in the window (low voltage) connect to the PCBA. Arrange wiring and check that it is not tensed.

2

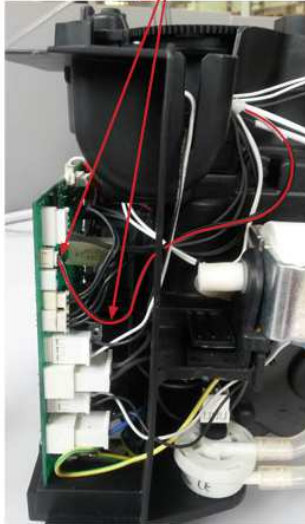

Connect to the water level sensor Pass the wiring of the hooks In the picture to see the position of the clamp.

3



ADDITIONAL INFORMATION:
SERIAL NUMBER (First serial where solution has been implemented in production):
TW901632444591 for Minuto
TW901633454107 for Incanto

IPM NUMBER (Philips Integrate Problem Management documentation reference number):
None

INFORMATION FOR CONSUMER:
None

HISTORY:
01/09/2016 - Second Release - Insert Serial Number
29/07/2016 - First Release