



Service information

Reference no.: SDA_80579

Symptom

Clogging / splashes in dispenser valve in Odea machines

Cure

INFO:
Brewing valve gets clogged and/or there are splashes in coffee dispenser.

CURE:
The spring and the valve (see image 1) must be removed from brewing valve (indicated in the exploded view with the code: 11007647).
The counter piston must be replaced by the kit code 20005362 (see image 2) which is made without needle and without diaphragm.

