



**Service information**

**Reference no.: SDA\_80818**

**Symptom**

Noise and vibration from pump in Talea and Odea lines

**Cure**

**INFO:**

Noise and vibration from the pump while functioning in Talea and Odea lines till the serial number 9009SA40033949.

**CURE:**

Replace the original pump's support (picture 1) with the modified one (picture 2): increased the part of gum (grey part) on the pump's support in order to have it till the bottom and in contact with the basement. Spare part code: 11006296. Spare part warehouse has been updated with the new modified parts.

