



Service information

Reference no.: SDA_81231

Symptom

Twisting / blockage / leakage of linen-faced silicone tube in Incanto and Royal

Cure


INFO:

Twisting / blockage / leakage of the linen-faced silicone tube in Incanto and Royal series.

Incanto series till the serial number: 9008SA40289955 and Royal till the serial number: 9009ROY0730752.

CURE:

Incanto and Royal: Insert a new longer tube (L= 290 mm; part code: 11001208) from boiler to boiler's pin positioning it correctly as shown in the image 1 and 2 in order to avoid the bending, and add a protective sheath (code 11010624).

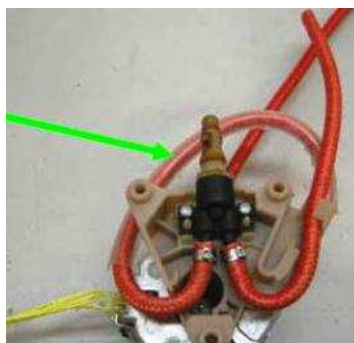

Royal Professional: Insert a new red tube (L = 240 mm; part code:11000756) from pump to boiler positioning it correctly in order to avoid bending, and insert also a new transparent tube (L = 200 mm; part code: 9972.166) from the safety valve to the discharge in the drip tray as shown in the picture 3.

