



## Service information

### Symptom

Steam/water leakage from stand

### Cure

INFO:


Cracks at boiler electro-valve will lead to steam/water leakage.  
The crack is the resultant of torsion stress during assembly process.



CURE:

Please replace the defective electro-valve. Service code: 4239 017 10901.

New electro-valve with improved design is introduced since 2010 July 23. The new part can be identified via the date code on the component body. Refer below picture.

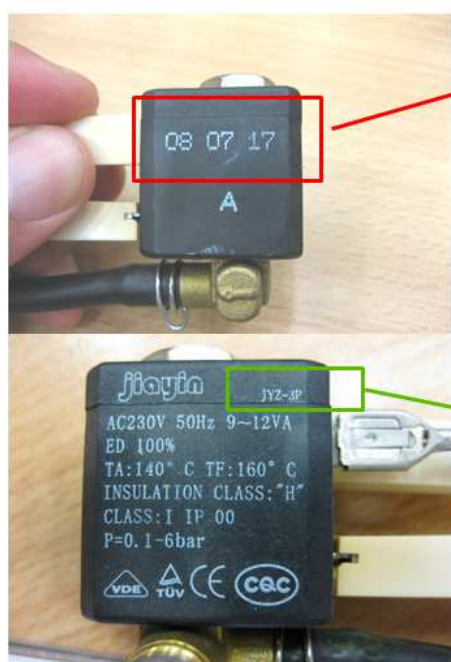

#### Effective date code:

Year Month Date

e.g.

10 07 23 or

2010 07 23

Electro-valve after this date – change implemented

Model: JYZ-3P

In addition, below picture shows the difference between the new part & the old part.



REMARKS:

It has been ensured that old stocks are purged & only new parts are on stock. Any new order will receive the new electro-valve.

**MANDATORY:**

Use only the new electro-valve for service repair.

HISTORY:

10 Nov 2010: Add picture showing difference between new & old part.