

#### Service information

Reference no.: SDA\_84870

### Symptom

Water or Steam leaking from Rinse tank interface during normal ironing usage

### Cure


Applicable for GC9020, GC9040 and GC9140

**Symptom:** Water or Steam leaking from Rinse tank interface during normal ironing usage (e.g. not Auto Calc Clean operation)

When rinse valve is unable to seal properly, unit will leak water and steam during heating up of the steam generator.



**Cure:** Replace CEME e-valve with Jiayin valve  
Electrovalve (90 deg) - diagraphm 4239 017 11581

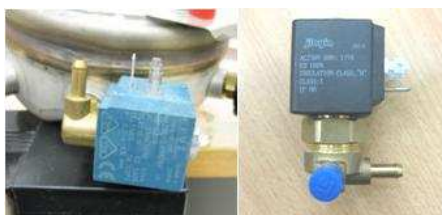

Electrovalve Mesh - diagraphm 4239 010 11101 (same original mesh can be used, replaced if damaged)