



Service information

Reference no.: SDA_85382

Symptom

Protection for boiler's linen-faced tube in Incanto and Gaggia Titanium

Cure

INFO:

The linen-faced tube, that connects the boiler to the pump, gets worn in contact with the boiler's protection (image 1).

Models concerned:

Incanto DLX 740825353 till the serial number: 9010SA40074204

Incanto BLACK 740825310 till the serial number: 9010SA40075159

Incanto DLX 740825310 till the serial number: 9010SA4009626

Gaggia Titanium: 93140C0019 till the serial number: 9010GA40188688

And all the other Incanto models that have two boilers.

CURE:

As mandatory rework, proceed as follows with the machines mentioned above that return to workshop for any reason: In case of replacement of parts that require the detachment of the tube in question, insert as protection a transparent silicone tube, code 11010624, L = 200 mm, as shown in the images below.

In order to facilitate the operation, if the tube in question doesn't need to be detached for other reasons, insert as protection a spiral rubber tube L=200mm, sold by meter with code 148950100.

Please see images 1 to 4.

