



Service information

Reference no.: SDA_85833

Symptom

Defective capacitors on power boards

Cure

INFO:

Problem with power board of supplier Systronics, "SY", that can cause different kind of functional symptoms to Xsmall, Odea Go, Talea, Syntia Cappuccino and Gaggia Unica espresso lines. To identify the supplier of the board, check the data label on the board (image 1).

CURE:

If on the Systronic's power board there is in the position mentioned below (image 2) the capacitor 330µF 50V, of supplier Nichicom (image 3) that has the initials "H0935" (image 4), replace the board. Check also your spare part stock.



Code board	Position Capacitor
11022509	C14
11022788	C19
11022890	C14
11025142	C14



Image 3



Image 4