



**Service information**

**Reference no.: SDA\_86782**

**Symptom**

Suction power decrease because dustbag gets stucked to Frame of Inletfilter

**Cure**

**SYMPTOM:**

When Dustbag is empty, it gets stock over the whole surface of the Inletfilter frame (pos. 13 in Serv. Manual), this is leading to suction power decrease

**INFO:**

Improved Inletfilter Frame to avoid this issue can be ordered per wk. 1120

**CURE:**

New Inletfilterframe's can be ordered under the new 12 NC's :

FC8130 : 4222 459 53281 (Pistil red)

FC8132 : 4222 459 53291 (Aubergine)

FC8134 : 4222 459 53301 (Green)

FC8135 : 4222 459 53311 (Blue)

**REMARK:**

Below new models already have this new Inletfilter Frame:

FC 8131 – FC 8133 and FC8135.