

#### Service information

## Symptom


## Reference no.: SDA\_92093

Water leakage

### Cure

INFO: From field quality analysis we have observed leakages in the appliance which can be solved, preventing Non Standard Exchanges.

CURE: Remove the top cover from the appliance, underneath you can see the "shower head" which sprays the hot water into the coffee-filter.

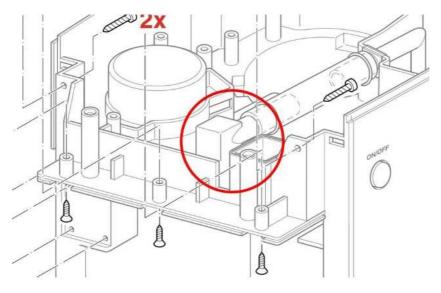

y seal the steam

vent joint between the appliances name and top cover, next to the shower nead, when you discover that the screw have been overturned / overtightened, it may help to fit slightly larger screws. It has been the case that the screw torque was not always well under control in the production line.

# (Tip: exchange the overturned screw by a screw from the base plate (under the rubber feet), this screw is slightly longer, the screw from the showerhead also fits in the base plate.)

REMARKS: - 26-03-2012: Initial version - 28-11-2012: Screws from the base plate are a suitable replacement for the overturned showerhead screw.