



Service information

Reference no.: SDA_930

Symptom

Water tank empty light always blinking (GC92xx)

Cure

Issues and Symptoms:

- Intermittent or non-detection of water tank in the appliance during usage.
- Steaming of iron intermittently stops during pumping cycles.
- Water tank empty light always blinking despite water tank is filled to MAX.



Product affected: GC92xx (Production week from wk1141 to wk1144)

Root causes of failure: Sensor cannot detect the presence of magnetic floater inside the water tank when water tank is engaged into the steam generator.

Symptom Cure:

To increase the sensing robustness by off-set mounting of sensor.



Before



After

Caution: Do not damage the wires connected to the PCB during the rework. Ensure all wires are properly dressed after off-set mounting of the sensor.