



**Service information**

**Reference no.: SDA\_94379**

**Symptom**

On Button doesn't work.

**Cure**

**INFO:**

The Handblender HR161X Range do not work, while using the ON Button. The Turbo mode works without any issues.

**CURE:**

- 1) Changed bare wire length at the PCBA from 6,0+/-1mm to 4,5+/-1mm to avoid the wire tilting to soldering point an causing bridge soldering
- 2) Add picture (good and poor sample) on WI for contrast to sure the operator could identified the poor unit.

**REMARKS:**

Actions have been implemented from June 15th 2012 onwards.