



Service information

Reference no.: SDA_96170

Symptom

Improvement of the brew unit lubrication.

Cure

INFO:

The condensation present in conveyor cone due to the usage of the machine, capture part of grinded coffee powder and start a process of reduction of hole of conveyor that continues in next grinding and brewing cycles until conveyor become completely clogged by wet and dry coffee powder.
In some case you got a watery coffee while in other cases the grinder assy become completely blocked and relative alarm raised by the machine.

CURE:

The general action consists in a lubricate of the brewing unit parts (Image1), mainly focused in the piston rod (Image2) to ensure the correct sliding on the gasket to avoids eventual water splashing that might cause deposits of ground coffee at the exit of the conveyor.

For internal order cod. 11028379 KLUBER TUBE 5GR.

