



Service information

Reference no.: SDA_96288

Symptom

Improvement assembly teflon tube and plastic support

Cure

INFO:

Possible damage of teflon tube or black plastic support (indicated in the image 1).

The assembly device of the teflon tube with plastic support used in production was not correctly calibrated and so could cause the damage of one or both the plastic fixing "wing". Consequently the assembled part can get broken during the insertion of the brew unit.

CURE:

Replace the damaged component cod.11005101 with a new one.

From serial number TU901230122604 the assembly device has been checked and calibrated to ensure the correct assembly of teflon tube and plastic support.

Image 1

