



Service information

Reference no.: SDA_96932

Symptom

NEW SW FOR XELSIS ID

Cure

INFO:

New software with changed hardware configuration in standby mode.

CURE:

Upload the new software V. 02.08.01

In Detail:

- Changed hardware configuration in standby mode to avoid the undesirable activation of AC loads.
- Added two software thermostats to give no power to coffee boiler and steam boiler when its boiler temperature reach respectively 140°C and 160°C.
- Fix Error 14 after descaling.