



**Service information**

**Reference no.: SDA\_96933**

**Symptom**

NEW SW FOR ENERGICA FOCUS

**Cure**

**INFO:**

New software with changed hardware configuration in standby mode, with new error codes dedicated to the overheating.

**CURE:**

Upload the new software V.02.03.01

**In Detail:**

- Changed hardware configuration in standby mode to avoid the undesirable activation of AC loads.
- Added two software thermostats to give no power to coffee boiler and steam boiler when its boiler temperature reach respectively 140°C and 160°C.
- Added two new error codes E20 and E21 to indicate respectively the overheating of coffee boiler ( $T \geq 150^\circ\text{C}$ ) and the overheating of steam boiler ( $T \geq 170^\circ\text{C}$ ) and improved its storing with an hysteresis of 5°C. The older error code E14 and E15 represent only a timeout to reach the temperature target.