



Service information

Reference no.: SDA_98068

Symptom

Damaged black inside cover front panel in Xelsis Line

Cure

INFO:

Black inside cover front panel of door broken at dispenser coffee inlet.(See Image 1).

While closing the door, the dispenser coffee inlet that goes inside the brew unit hole, push the plastic ring on border and could damage it.

CURE:

Replace the black inside cover frontal panel with new ones according to the below code and models matching table:

421944006981 BLK INSIDE COVER FRONT PANEL V4 MYB9/H **For Xelsis**

996530073363 BLK INSIDE COVER FRONT PANEL V3 MYB9/T **For Xelsis ID**

Image 1

