



Service information

Symptom

Water is leaking out of the appliance

Cure

SYMPTOM:

Water is leaking out of the appliance FC7070

CURE:

To avoid this problem, 2 components can be added to the appliance during repair :


Spring 432200000371 (pos. 55 in Serv. Manual and Service BOM)
Tiewrap 432200175211 (pos. 56 in Serv. Manual and Service BOM)

Goal is to avoid kinking of the water hoses which cause the leakage of water.

For repair instructions, see separate Word file.

Reference no.: SDA_99172

Proposal to ensure the water distribution in Aqua Trio by adding 2 springs in water hoses.
Goal is to avoid kinking of the water hoses which cause lack of water.

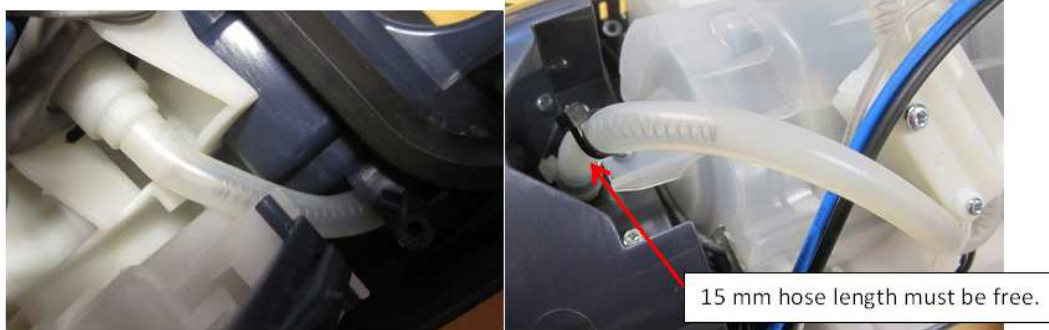

Add a spring to the water hose from the clean water tank outlet to the water sensor.
The spring can be the same as the present used springs (4322 000 00371).
The spring must be fixed with a Tie wrap (4322 001 75211).
The distance is +/- 15 mm from the end to ensure that there is enough hose length to push the hose on the inlet piece.



Add a hose spring to the hose from the water pump to the water inlet piece to the brush.
Use the same spring (4322 000 00371) as already used.
The spring must be fixed with a Tie wrap (4322 001 75211).
Therefor the used hose should be replaced by the same hose (inner and outer) diameter as used for water distribution in the lower stick.
Length must be the same as present pump outlet hose.

H.Linde
19-02-2013