



**Service information**

**Reference no.: SDA\_108018**

**Symptom**


Appliance does not heat due to blown boiler TRIAC SLD

**Cure**

**INFO:**

The cause for the Boiler TRIAC to blow, is likely to be an earth leakage of the boiler, therefore the boiler must be preventively replaced.

Please refer to attached image for an overview of the back (solder side) of the PCBA, and the area to inspect.

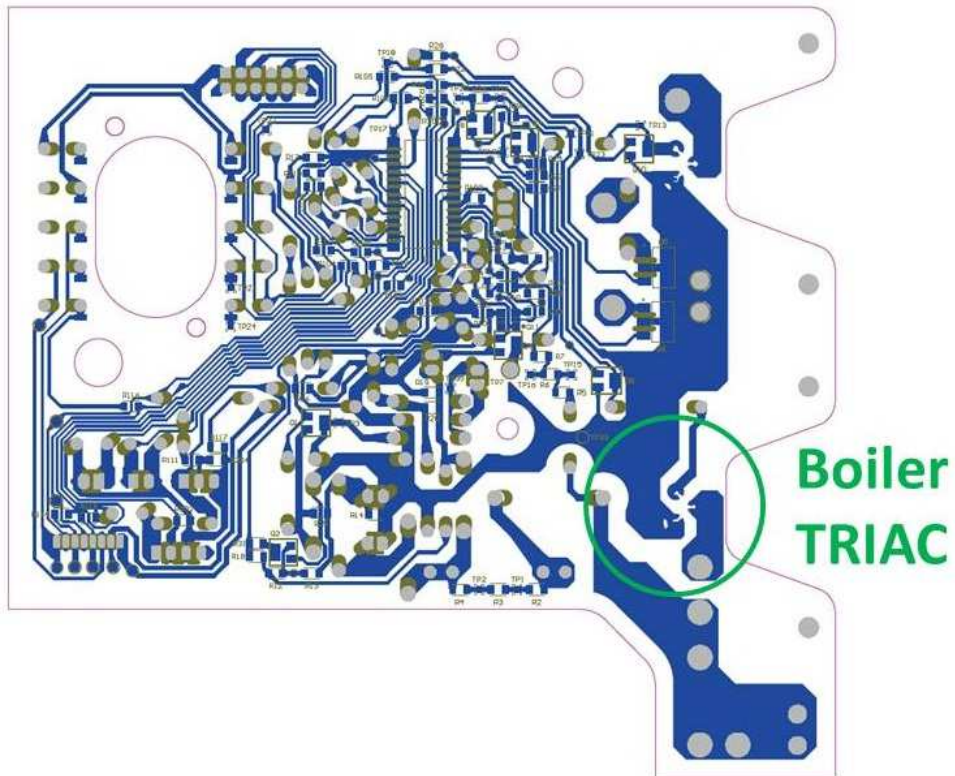

**CURE:**

Apart from the PCBA

- 42225960301

also replace the Boiler

- 42225952091

**REMARKS:**

- 30-09-2014: Intial version