



Service information


Symptom

Exhaust grille is hard to mount

Cure

INFO: After some complaints it was found that due to too much sealing material used in the AFS filter support (Pos.39) there is too much tension on the Exhaust grille, causing it to pop out

CURE: Please replace AFS support 432200518070, this should solve the problem. (PS. problem will also solve itself, after some use/heating up the sealing will adjust itself) Optional soluti

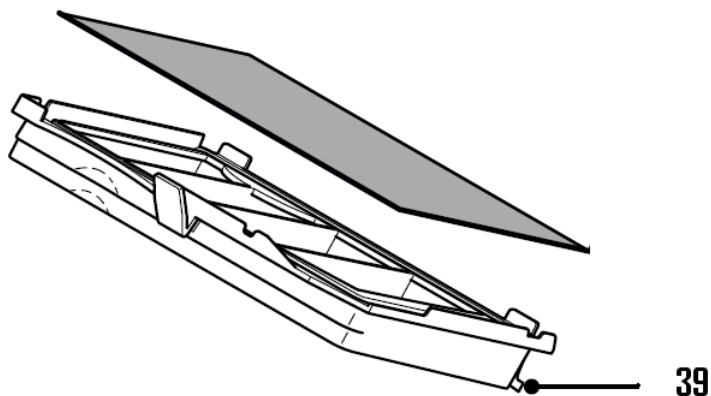

below)

