

Service information

Reference no.: SDA_97068

Symptom



Tophousing is deformed and/or button is melted

Cure

Symptom:
Tophousing is deformed and/or button is melted

INFO:
Blockage because of dirt in the Dustchamber, motor gets overheated and housing and/or button will melt

CURE:
Change the Dustbagholder to guarantee that dust will not block the airflow and motor will not get overheated anymore.

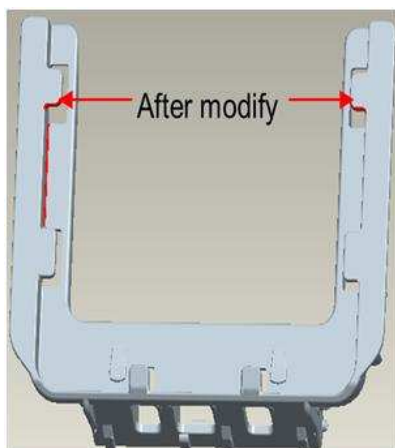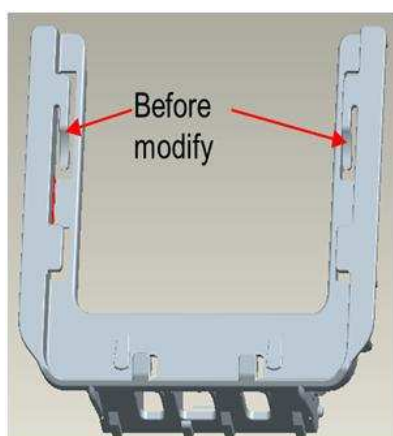

Remark:
Implemented in production per 1-1-2013