Service information

Reference no.: SDA_87008

Symptom

Steam and water pump function interchanged

Cure

INFO:
it has come to our attention that there are incidents accurring with Senseo Latte or Cappuccino Select appliances, where apparently the function of the Steam and Water pump/heater is interchanged. Due to a manual repair process the possibility is introduced to reverse leads on the PCBA. This reversion is (apparently) not noticed during functional testing.

CURE:
Reverse the white and yellow leads on the PCBA, back to their original destination. The position marked "Yellow" should be occupied by the yellow lead, the position marked "White" should be occupied by the white lead.

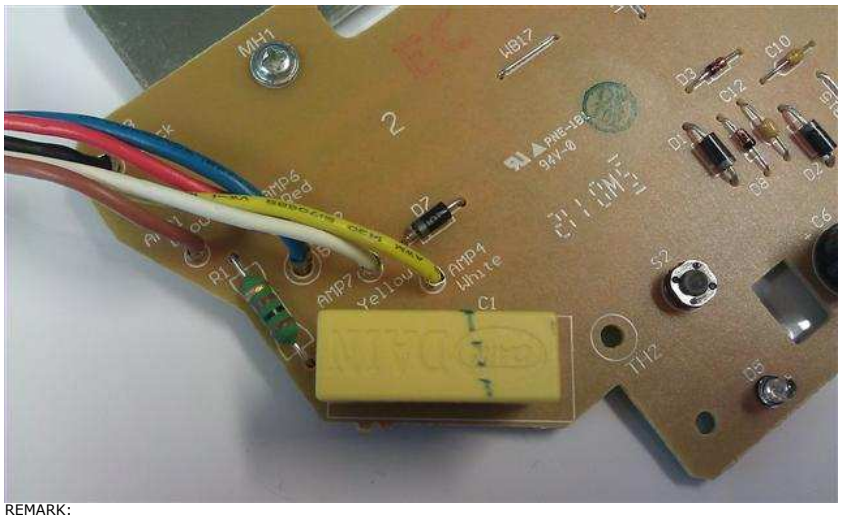

REMARK:
The is no safety risk involved, nor is there any damage done the PCBA because of this reversal. Please carry out a full functional test of the appliance to make sure all functions are available again.