



Service information

Reference no.: SDA_83598

Symptom

ON-OFF defect, Unit doesn't turn on


Cure

Symptoms: Unit doesn't turn on, Unit goes off when switching steam selection

Products affected:

GC8510, GC8520, GC8560, GC8565 with production week code: Wk1009-Wk1016

Cause: Intermittent connection on power-switch resulting in no close connection on switches. Product after affected production week 100% re-worked.

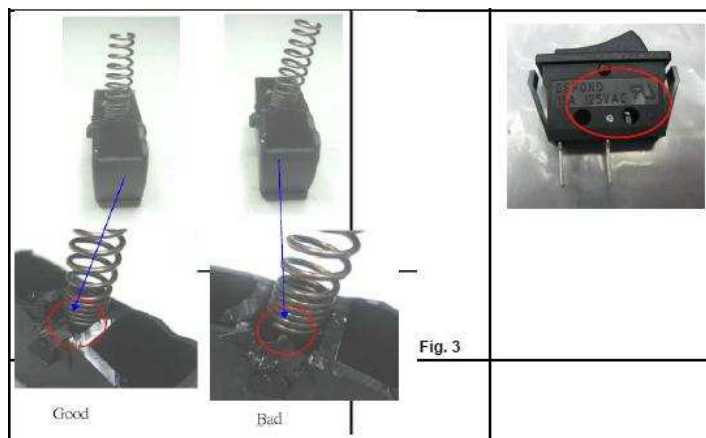

Cure: Replace Display Panel printed assy (Position 47). In this manner, affected switch module replaced.

GC8510 4239 021 50421

GC8520 4239 021 57031

GC8560 4239 021 57121

GC8565 4239 021 50601