



Service information

Reference no.: SDA_91284

Symptom

Royal and Magic line, modified ratiomotor.

Cure


INFO:

In the Royal Line and Magic Line coffee machines, from serial number TV901202001268, has been modified the wheelbase of the fastening pin to avoid the broken of gears of the brew unit positioning system..

CURE:

Following the change to the wheelbase of the fastening pin (image1), if you replace the gears in a machine with serial number up to TV901202001268, you need to replace the ratiomotor lid and the ratiomotor casing assembly. For this is available the kit cod. 20007052.

The new ratiomotor lid, has a punching under the molded number (Image2), while the new ratiomotor casing has a punching and a letter "N" (Image3).

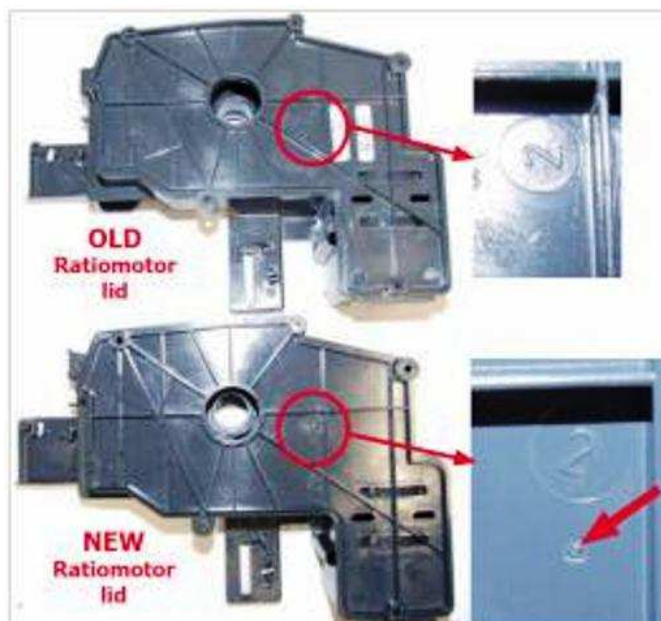

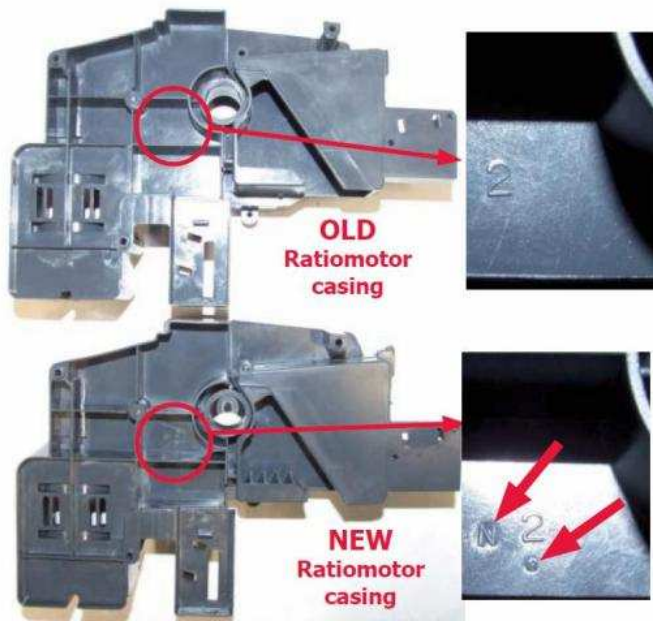


Image3